


Rules on letting this property

Properties can be let if they have an energy rating from A to E.

You can read <u>guidance</u> for <u>landlords</u> on the <u>regulations</u> and <u>exemptions</u> (<u>https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-quidance</u>).

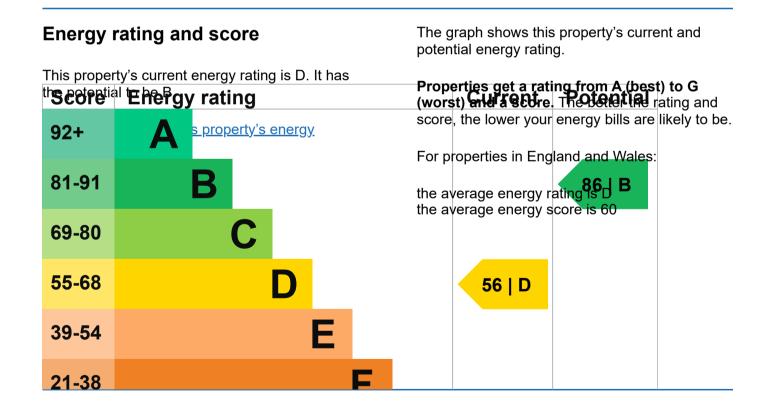

Breakdown of property's energy performance

This section shows the energy performance for features of this property. The assessment does not consider the condition of a feature and how well it is working.

Each feature is assessed as one of the following:

- · very good (most efficient)
- good
- average
- poor
- very poor (least efficient)

When the description says "assumed", it means that the feature could not be inspected and an assumption has been made based on the property's age and type.

Feature	Description	Rating
Wall	Cavity wall, as built, no insulation (assumed)	Poor
Roof	Pitched, no insulation	Very poor
Roof	Flat, no insulation (assumed)	Very poor
Window	Mostly double glazing	Average
Main heating	Boiler and radiators, mains gas	Good
Main heating control	Programmer and room thermostat	Average
Hot water	From main system	Average
Lighting	Low energy lighting in all fixed outlets	Very good
Floor	Solid, no insulation (assumed)	N/A
Secondary heating	None	N/A

Primary energy use

The primary energy use for this property per year is 265 kilowatt hours per square metre (kWh/m2).

Additional information

Additional information about this property:

· Cavity fill is recommended

Environmental impact of this property

This property's current environmental impact rating is E. It has the potential to be B.

Properties get a rating from A (best) to G (worst) on how much carbon dioxide (CO2) they produce each year. CO2 harms the environment.

An average household 6 tonnes of CO2 produces

This property produces 5.1 tonnes of CO2

This property's potential 1.2 tonnes of CO2 production

You could improve this property's CO2 emissions by making the suggested changes. This will help to protect the environment.

Environmental impact ratings are based on assumptions about average occupancy and energy use. They may not reflect how energy is consumed by the people living at the property.

Improve this property's energy rating

Step	Typical installation cost	Typical yearly saving
1. Increase loft insulation to 270 mm	£100 - £350	£141.72
2. Cavity wall insulation	£500 - £1,500	£141.29
3. Floor insulation	£800 - £1,200	£35.33
4. Heating controls (TRVs)	£350 - £450	£25.61
5. Condensing boiler	£2,200 - £3,000	£127.35
6. Solar water heating	£4,000 - £6,000	£26.94
7. Solar photovoltaic panels	£9,000 - £14,000	£246.83

Paying for energy improvements

You might be able to get a grant from the <u>Boiler Upgrade Scheme (https://www.gov.uk/apply-boiler-upgrade-scheme)</u>. This will help you buy a more efficient, low carbon heating system for this property.

Estimated energy use and potential savings

Based on average energy costs when this EPC was created:

Estimated yearly energy cost for this property	£1034
Potential saving if you complete every step in order	£498

The estimated cost shows how much the average household would spend in this property for heating, lighting and hot water. It is not based on how energy is used by the people living at the property.

Heating use in this property

Heating a property usually makes up the majority of energy costs.

Estimated energy used to heat this property

Type of heating	Estimated energy used	
Space heating	13609 kWh per year	
Water heating	2237 kWh per year	
Potential energy savings by installing insulation		
Type of insulation	Amount of energy saved	
Loft insulation	2695 kWh per year	
Cavity wall insulation	2690 kWh per year	

Saving energy in this property

Find ways to save energy in your home by visiting www.gov.uk/improve-energy-efficiency.

Contacting the assessor and accreditation scheme

This EPC was created by a qualified energy assessor.

If you are unhappy about your property's energy assessment or certificate, you can complain to the assessor directly.

If you are still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation schemes are appointed by the government to ensure that assessors are qualified to carry out EPC assessments.

Assessor contact details

Assessor's name Michael Collier Telephone 01435882628

Email <u>claywoodenergy@hotmail.co.uk</u>

Accreditation scheme contact details

Accreditation scheme Stroma Certification Ltd

Assessor ID STRO009903 Telephone 0330 124 9660

Email <u>certification@stroma.com</u>

Assessment details

Assessor's declaration

Date of assessment

Date of certificate

Type of assessment

No related party
22 May 2013
22 May 2013
RdSAP